




# NOVA-FLEX

PRINTABLE 7000 white

# NOVA-TACKY

TRANSFER TAPE

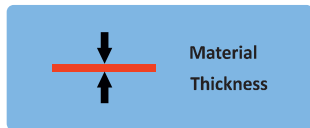

## White (for Solvent, Eco-Solvent Inkjet printers)

7561 matt

7562 glossy

85µm 3,4 mil	Material	PU White face film Copolyester Hotmelt
	Carrier	Pressure Sensitive Adhesive Polyester Film 100µm

100% Cotton,  
Polyester / Acrylic  
and Mixtures

	150 °C = 302 °F
	15 sec.
	3-4 bar ≈ 43-58 psi medium pressure

Wash textile inside out			
60°C 140°F	DRYCLEAN	TUMBLE DRY	DO NOT use BLEACH

## White (for Solvent, Eco-Solvent, Latex Inkjet printers)

7565 matt

7566 glossy

55µm 2,2 mil	Material	PU White face film Copolyester Hotmelt
	Carrier	Pressure Sensitive Adhesive Polyester Film 100µm

100% Cotton,  
Polyester / Acrylic  
and Mixtures  
also for Nylon and  
coated fabrics

	150 °C = 302 °F
	15 sec.
	3-4 bar ≈ 43-58 psi medium pressure

Wash textile inside out			
60°C 140°F	DRYCLEAN	TUMBLE DRY	DO NOT use BLEACH

## White (for Solvent, Eco-Solvent Inkjet printers with Sublistop layer)

7701 matt

135µm 5,3 mil	Material	PU White face film PU Hotmelt
	Carrier	Pressure Sensitive Adhesive Polyester Film 100µm

for  
Sublimated  
fabrics

	135 °C = 275 °F
	10 sec.
	3-4 bar ≈ 43-58 psi medium pressure

Wash textile inside out			
40°C 104°F	DRYCLEAN	TUMBLE DRY	DO NOT use BLEACH