

NOVA-FLEX

PRINTABLE 7000 white

NOVA-TACKY

TRANSFER TAPE

Application steps

- 1 Print the flex and cut it by cutting plotter,
- 2 Weed the exceeding material,
- 3 Apply the NOVA-TACKY AT003 Transfer Tape to lift the printed Flex from the original carrier. Best flip it over so the polyester carrier is on top and remove with 180°,
- 4 Press the garment for 2-3 sec.(to take the moisture out),
Do Not prepress the garment for 7701,
- 5 Place the Flex material on the garment with the Transfer Tape AT003 facing up,
- 6 Heat press with the mentioned parameters,
- 7 Remove the Transfer Tape AT003 hot,
- 8 Press again for 2-3 sec. at same parameters with an Antistick paper on top.



We recommend to make the cutting test with your plotter before proceeding with production



Suitable for:
see back page



Yes, but only on PU Flex




Hot Peel




For heat pressing & washing instructions + material thicknesses, see back page

Remarks

- Due to different quality of garments & heat presses in the market, we recommend evaluation tests before any application.
- Please follow the washing instructions of the garment and iron on the back side.
- All information mentioned is based on our tests in the lab.
- The materials used are ecologically safe and do not contain heavy metals, plasticizers or PVC
- NovaFlex 7000 series has a self-adhesive polyester liner to enable repositioning of accidentally removed letters.
- Nylon or textiles that are hydrophobic impregnated must be heat pressed with 7565 or 7566.
- NovaFlex 7701 is available with a blackout intermediate layer and has an excellent sublimation resistance. We recommend to test before using this product as subli-stop on various sublimated fabrics.
- Novaflex 7000 series can be printed with solvent and eco solvent inks, but 7565 and 7566 can also be printed with latex ink.
- Transferring the NovaFlex Printables 7000 series with the Nova-Tacky polyester Transfer Tape AT003, allows safe positioning on garments before production.

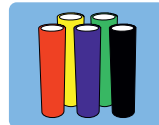

For best results we recommend to store the rolls vertically and away from heat, moisture & direct sunlight

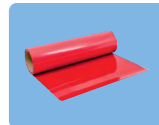

Nova-Flex Printable roll sizes: 500mm x 25m, approx 20" x 27 yds other dimensions available on request



Nova-Tacky AT003 polyester transfer tape, roll sizes: 500mm x 10m, approx 20" x 11 yds other dimensions available on request